



Thermistor Elements

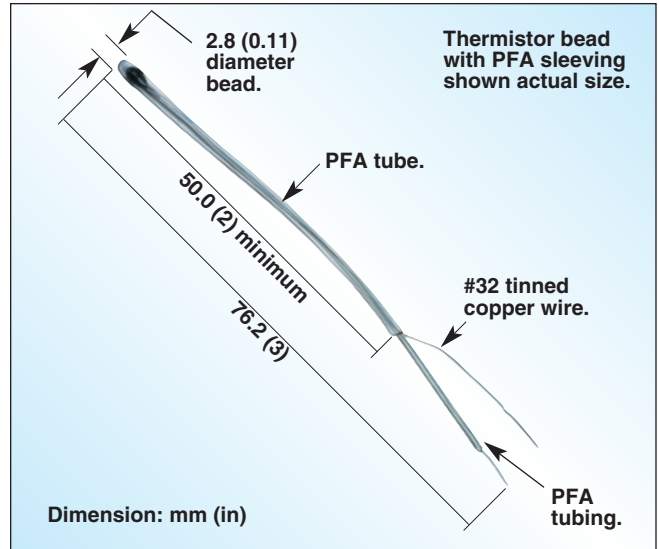

44000 Series
Starts at
\$15

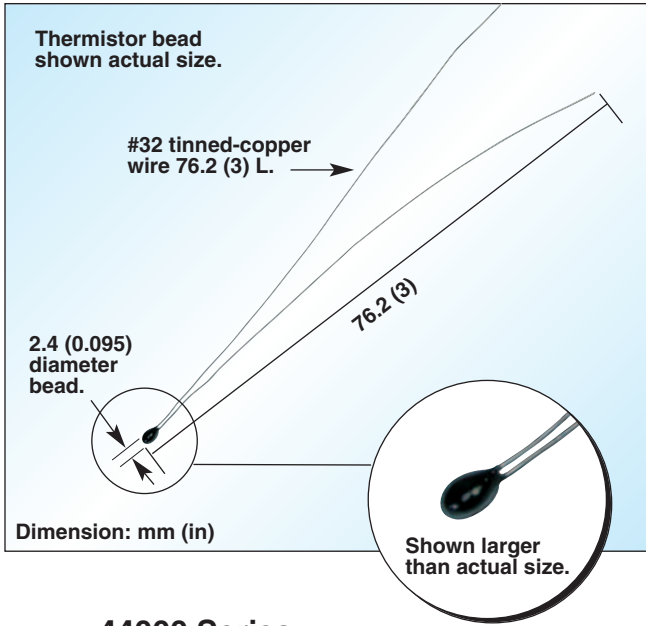

- ✓ Epoxy Coated Thermistor Beads
- ✓ Precision Matched to 5 Standardized Resistance Curves
- ✓ Maximum Working Temperature 75°C (165°F) or 150°C (300°F) (See Table Below)
- ✓ Available in Interchangeabilities of ±0.1 or ±0.2°C (See Table Below)

Resistance Vs. Temperature Characteristics

The Steinhart-Hart Equation has become the generally accepted method for specifying the resistance vs. temperature characteristics for thermistors. The Steinhart-Hart equation for temperature as a function of resistance is as follows:

$$\frac{1}{T} = A + B [\ln(R)] + C [\ln(R)]^3$$

where: A, B and C are constants derived from 3 temperature test points.

R = Thermistor's resistance in Ω

T = Temperature in degrees K

Table 1: Steinhart-Hart Constants

Model Number	Model Number	R25°C	A	B	C
44004	44033	2252	1.468 x 10 ⁻³	2.383 x 10 ⁻⁴	1.007 x 10 ⁻⁷
44005	44030	3000	1.403 x 10 ⁻³	2.373 x 10 ⁻⁴	9.827 x 10 ⁻⁸
44007	44034	5000	1.285 x 10 ⁻³	2.362 x 10 ⁻⁴	9.285 x 10 ⁻⁸
44006	44031	10000	1.032 x 10 ⁻³	2.387 x 10 ⁻⁴	1.580 x 10 ⁻⁷
44008	44032	30000	9.376 x 10 ⁻⁴	2.208 x 10 ⁻⁴	1.276 x 10 ⁻⁷

To determine the thermistor resistance at a specific temperature point, the following equation is used:

$$R = e^{(\beta - (\alpha/2))^{1/3} - ((\beta + (\alpha/2))^{1/3})}$$

where:

$$\alpha = ((A - (1/T))/C)$$

$$\beta = \text{SQRT}(((B/(3C))^3) + (\alpha^2/4))$$

$$T = \text{Temperature in Kelvin } (^\circ\text{C} + 273.15)$$

The A, B and C constants for each of our thermistor selections can be found in Table 1. Using these constants with the above equations, you can determine the temperature of the thermistor based on its resistance, or determine a thermistor's resistance at a particular temperature.

Typical Thermometric Drift (±0.2°C Elements)

Operating Temp	10 Months	100 Months
0°C	<0.01°C	<0.01°C
25°C	<0.01°C	0.02°C
100°C	0.20°C	0.32°C
150°C	1.5°C	Not recommended

Tolerance Curves

Accuracy tolerances for thermistor sensors are expressed as a percentage of temperature. This is also referred to as interchangeability. We list two basic accuracy/interchangeability specifications for our thermistors, $\pm 0.10^{\circ}\text{C}$ and $\pm 0.20^{\circ}\text{C}$ from 0 to 70°C (32 to 158°F).

Table 2: Interchangeability Tolerances

Temp ($^{\circ}\text{C}$)	Model No. 44004 $\pm 0.20^{\circ}\text{C}$		Model No. 44033 $\pm 0.10^{\circ}\text{C}$	
	$\pm^{\circ}\text{C}$	$\pm\Omega$	$\pm^{\circ}\text{C}$	$\pm\Omega$
-80	1.00	142,000	1.00	142,000
-40	0.40	2018	0.20	1009
0	0.20	75	0.10	38
40	0.20	10	0.10	4.9
70	0.20	2.7	0.10	1.4
100	0.30	1.3	0.15	0.7
150	1.00	0.9	1.00	0.9

Note: Temperature values ($^{\circ}\text{C}$) are the same for each tolerance group (± 0.10 or ± 0.20), resistance tolerances will change based on resistance at 25°C (77°F).

Temperature vs. resistance tables for our thermistor products can be found on pages Z-236 and Z-237. The accuracy specification of $\pm 0.1\%$ or 0.2% means that each thermistor's resistance will fall within these limits between 0 and 70°C (32 and 158°F). Table 2 illustrates the interchangeability values for the model numbers 44004 ($\pm 0.2^{\circ}\text{C}$) and 44033 ($\pm 0.1^{\circ}\text{C}$) at a number of temperatures.

Stability and Drift

While thermistors are generally very accurate and stable devices, conditions such as over-temperature exposure, humidity, mechanical damage or corrosion can cause uncontrolled changes in the resistance vs. temperature characteristics of the device. Once this characteristic has been altered, it cannot be re-established. This is one reason why most thermistors with a $\pm 0.1^{\circ}\text{C}$ interchangeability specification are rated for use at temperatures somewhat lower than those with an interchangeability of $\pm 0.2^{\circ}\text{C}$.

Operating Current

The suggested operating current for bead-style thermistors is approximately 10 to 15 μA . Thermistors can experience self-heating effects if their operating currents are high enough to create more heat than can be dissipated from the thermistor under operating conditions. If higher operating currents are used, it is suggested that a self heating test be performed to insure the accuracy of the measurement.

Dissipation Constant

The dissipation constant is the power in milliwatts that will raise the resistance of a thermistor by 1°C (1.8°F) over its surrounding temperature. Typical values include 8 $\text{mW}/^{\circ}\text{C}$ in a stirred oil bath, or 1 $\text{mW}/^{\circ}\text{C}$ in still air.

Time Constant

The time constant is the time required for a thermistor to react to a step change in temperature. For example, if exposed to a change from 0 to 100°C (32 to 212°F), the 63% time constant would be the time required for the thermistor to indicate a resistance at 63°C (145°F). Typically, bare thermistors suspended by their leads in a well stirred oil bath will have a 63% response time of 1 second maximum. PFA encased thermistors exposed to changes in air temperature will typically have a 63% response time of 2.5 seconds maximum.

Discount Schedule

1 to 9Net
10 to 2410%
25 to 4920%
50 to 9930%
100 and over40%

MOST POPULAR MODELS HIGHLIGHTED!

To Order (Specify Model Number)					
Model Number	Price (Each)	Resistance @ 25°C (Ω)	Maximum Working Temp	Interchangeability @ 0 to 70°C	Storage and Working Temp for Best Stability
44004	\$15	2252	150°C (300°F)	$\pm 0.2^{\circ}\text{C}$	-80 to 120°C (-110 to 250°F)
44005	15	3000	150°C (300°F)	$\pm 0.2^{\circ}\text{C}$	-80 to 120°C (-110 to 250°F)
44007	15	5000	150°C (300°F)	$\pm 0.2^{\circ}\text{C}$	-80 to 120°C (-110 to 250°F)
44006	15	10,000	150°C (300°F)	$\pm 0.2^{\circ}\text{C}$	-80 to 120°C (-110 to 250°F)
44008	15	30,000	150°C (300°F)	$\pm 0.2^{\circ}\text{C}$	-80 to 120°C (-110 to 250°F)
44033	\$22	2252	75°C (165°F)	$\pm 0.1^{\circ}\text{C}$	-80 to 75°C (-110 to 165°F)
44030	22	3000	75°C (165°F)	$\pm 0.1^{\circ}\text{C}$	-80 to 75°C (-110 to 165°F)
44034	22	5000	75°C (165°F)	$\pm 0.1^{\circ}\text{C}$	-80 to 75°C (-110 to 165°F)
44031	22	10,000	75°C (165°F)	$\pm 0.1^{\circ}\text{C}$	-80 to 75°C (-110 to 165°F)
44032	22	30,000	75°C (165°F)	$\pm 0.1^{\circ}\text{C}$	-80 to 75°C (-110 to 165°F)

Note: Thermistor elements are available with PFA sleeving over 1 lead wire and PFA overall, change middle digit model number to "1" and add \$24 to the base price for the $\pm 0.2^{\circ}\text{C}$ thermistors and add \$49 for the price of the $\pm 0.1^{\circ}\text{C}$ thermistors.

Ordering Examples: 44004, 2252 Ω thermistor bead at 25°C , $\pm 0.2^{\circ}\text{C}$ interchangeability, \$15. 44033, 2252 Ω thermistor bead at 25°C , $\pm 0.1^{\circ}\text{C}$ interchangeability, \$22.

44104, 2252 Ω thermistor bead at 25°C , $\pm 0.2^{\circ}\text{C}$ interchangeability with PFA insulated lead wire and over-jacket, \$15 + 24 = \$39.

44033, 2252 Ω thermistor bead at 25°C , $\pm 0.1^{\circ}\text{C}$ interchangeability with PFA insulated lead wire and over-jacket, \$22 + 49 = \$71.



UNITED STATES

www.omega.com
1-800-TC-OMEGA
Stamford, CT.

CANADA

www.omega.ca
Laval(Quebec)
1-800-TC-OMEGA

GERMANY

www.omega.de
Deckenpfronn, Germany
0800-8266342

UNITED KINGDOM

www.omega.co.uk
Manchester, England
0800-488-488

FRANCE

www.omega.fr
Guyancourt, France
088-466-342

CZECH REPUBLIC

www.omegaeng.cz
Karviná, Czech Republic
596-311-899

BENELUX

www.omega.nl
Amstelveen, NL
0800-099-33-44



More than 100,000 Products Available!

• Temperature

Calibrators, Connectors, General Test and Measurement Instruments, Glass Bulb Thermometers, Handheld Instruments for Temperature Measurement, Ice Point References, Indicating Labels, Crayons, Cements and Lacquers, Infrared Temperature Measurement Instruments, Recorders Relative Humidity Measurement Instruments, RTD Probes, Elements and Assemblies, Temperature & Process Meters, Timers and Counters, Temperature and Process Controllers and Power Switching Devices, Thermistor Elements, Probes and Assemblies, Thermocouples Thermowells and Head and Well Assemblies, Transmitters, Wire

• Flow and Level

Air Velocity Indicators, Doppler Flowmeters, Level Measurement, Magnetic Flowmeters, Mass Flowmeters, Pitot Tubes, Pumps, Rotameters, Turbine and Paddle Wheel Flowmeters, Ultrasonic Flowmeters, Valves, Variable Area Flowmeters, Vortex Shedding Flowmeters

• pH and Conductivity

Conductivity Instrumentation, Dissolved Oxygen Instrumentation, Environmental Instrumentation, pH Electrodes and Instruments, Water and Soil Analysis Instrumentation

• Data Acquisition

Auto-Dialers and Alarm Monitoring Systems, Communication Products and Converters, Data Acquisition and Analysis Software, Data Loggers Plug-in Cards, Signal Conditioners, USB, RS232, RS485 and Parallel Port Data Acquisition Systems, Wireless Transmitters and Receivers

• Pressure, Strain and Force

Displacement Transducers, Dynamic Measurement Force Sensors, Instrumentation for Pressure and Strain Measurements, Load Cells, Pressure Gauges, Pressure Reference Section, Pressure Switches, Pressure Transducers, Proximity Transducers, Regulators, Strain Gages, Torque Transducers, Valves

• Heaters

Band Heaters, Cartridge Heaters, Circulation Heaters, Comfort Heaters, Controllers, Meters and Switching Devices, Flexible Heaters, General Test and Measurement Instruments, Heater Hook-up Wire, Heating Cable Systems, Immersion Heaters, Process Air and Duct, Heaters, Radiant Heaters, Strip Heaters, Tubular Heaters