













# Wire Insulation Identification

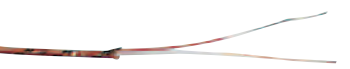Insulation Code	Insulation		Appearance of Thermocouple Grade Wire	Temperature Range, Insulation	Abrasion Resistance	Flexibility	Water Submersion
	Overall	Conductors					
<b>PP</b> (Extension Grade-EXPP)	Polyvinyl Chloride (PVC)	Polyvinyl Chloride (PVC)		-40 to 105°C -40 to 221°F	Good	Excellent	Good
<b>FF</b> (Extension Grade-EXFF)	FEP or Neoflon	FEP or Neoflon		-200 to 200°C -338 to 392°F	Excellent	Good	Excellent
<b>TT</b> (Extension Grade-EXTT)	PFA or Neoflon	PFA or Neoflon		-267 to 260°C -450 to 500°F	Excellent	Good	Excellent
<b>KK</b>	Kapton	Kapton		-267 to 260°C -450 to 500°F	Excellent	Good	Good
<b>TG</b>	Glass Braid	PFA or Neoflon		-73 to 260°C -100 to 500°F	Good	Good	Excellent
<b>GG</b> (Extension Grade-EXGG)	Glass Braid	Glass Braid		-73 to 482°C -100 to 900°F	Poor	Good	Poor
<b>HH</b>	High Temp Glass Braid	High Temp Glass Braid		-73 to 871°C -100 to 1300°F	Poor	Good	Poor
<b>XR</b>	Refrasil Braid	Refrasil Braid		-73 to 871°C -100 to 1600°F	Poor	Good to 315°C (600°F)	Poor to 315°C (600°F)
<b>XC</b> Standard Braid XL-Loose Braid XT-Tight Braid	Nextel Braid	Nextel Braid		-73 to 1204°C -100 to 2200°F	Poor	Good	Poor
<b>XS</b>	Silica	Silica		-73 to 1038°C -100 to 1990°F	Poor	Good	Poor
<b>TFE</b>	TFE	TFE		-267 to 260°C -450 to 500°F	Excellent	Good	Excellent




ANSI color code shown  
To order IEC color code visit [omega.com](http://omega.com)

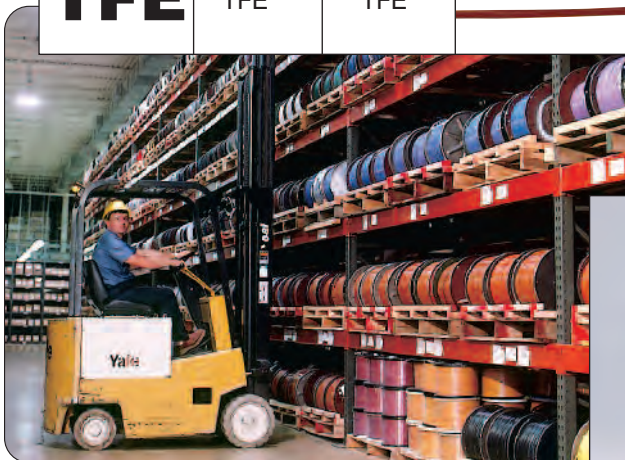

# and Application Guide

Resistance To:					Comments
Solvent	Acid	Base	Flame	Humidity	
Fair	Good	Good	Good	Good	Color Coded PVC Extruded Over Each Bare Wire. PVC Applied Over Insulated Primaries. Affected by Ketones, Esters
Excellent	Excellent	Excellent	Excellent	Excellent	Color Coded FEP Extruded Over Each Bare Wire. FEP Applied Over Insulated Primaries. Superior Abrasion and Moisture Resistance.
Excellent	Excellent	Excellent	Excellent	Excellent	Color Coded PFA Extruded Over Each Bare Wire. PFA Jacket Extruded Over Insulated Primaries. Superior Abrasion and Moisture Resistance. Same Basic Characteristics as FEP but Higher Temperature Rating
Good	Good	Good	Good	Excellent	Fused Kapton Tape Approx. 0.15 mm Applied to Conductors. A 0.10 mm Jacket Is Then Applied to Both. Excellent Moisture and Abrasion Resistance, High Dielectric Strength (7 kV/mil) Retains Much Physical Integrity After Gamma Radiation. FEP Is Used as Adhesive Binding Agent (Melts at approx. 260°C [500°F])
Excellent	Excellent	Excellent	Excellent	Excellent	PFA Extruded Over Each Bare Wire and a Glass Braid on the Jacket. May Be Used for Single Measurement to 343°C (650°F)
Excellent	Excellent	Excellent	Excellent	Fair	0.12 mm Glass Braid Over Each Conductor, and Binder Impregnated. Overall Glass Braid Applied and Binded. Binder Improves Moisture and Abrasion Resistance but Is Destroyed Above 204°C (400°F)
Excellent	Excellent	Excellent	Excellent	Fair	High Temp. Glass Braid Over Each Conductor, and Binder Impregnated. Overall High Temp Glass Braid Applied and Binded. Binder Improves Moisture and Abrasion Resistance but Is Destroyed Above 400°F
Excellent	Good to 315°C (600°F)	Good to 315°C (600°F)	Excellent	Poor	Braid of Vitreous Silica Fiber Applied to Each Bare Wire, Then Over Both. Suitable to 982°C (1800°F) if Not Subjected to Flexure or Abrasion
Excellent	Good	Good	Excellent	Fair	High Temp, Alumina-Boria-Silica Ceramic Fiber Braided Over Each Conductor Then Over Both. Not Recommended for Platinum Thermocouples or Exposure to Molten Tin and Copper, Hydrofluoric or Phosphoric Acids, or Strong Alkalies
Excellent	Good	Poor	Excellent	Fair	Silica Is a Very High Purity, Chemically Stable Yarn. (SiO <sub>2</sub> Content 99%)
Excellent	Excellent	Excellent	Excellent	Excellent	Color Coded TFE Tape Applied to Conductors and Jacket. Superior Abrasion, Moisture, and Chemical Resistance.

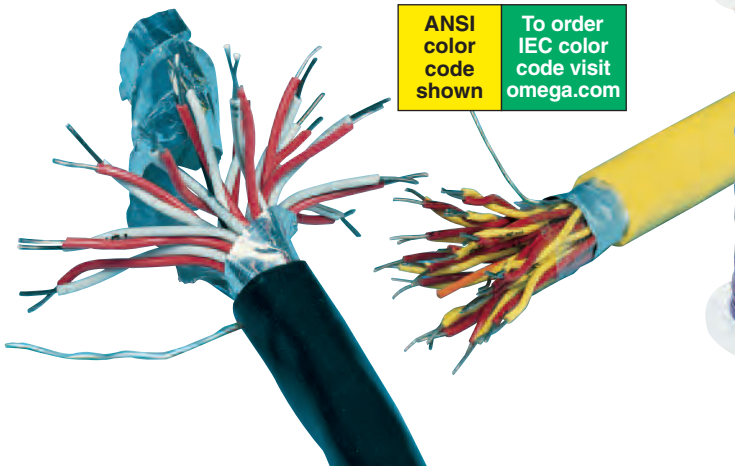

ANSI color code shown  
To order IEC color code visit [omega.com](http://omega.com)



H



#### UNITED STATES

[www.omega.com](http://www.omega.com)  
1-800-TC-OMEGA  
Stamford, CT.

#### CANADA

[www.omega.ca](http://www.omega.ca)  
Laval(Quebec)  
1-800-TC-OMEGA

#### GERMANY

[www.omega.de](http://www.omega.de)  
Deckenpfronn, Germany  
0800-8266342

#### UNITED KINGDOM

[www.omega.co.uk](http://www.omega.co.uk)  
Manchester, England  
0800-488-488

#### FRANCE

[www.omega.fr](http://www.omega.fr)  
Guyancourt, France  
088-466-342

#### CZECH REPUBLIC

[www.omegaeng.cz](http://www.omegaeng.cz)  
Karviná, Czech Republic  
596-311-899

#### BENELUX

[www.omega.nl](http://www.omega.nl)  
Amstelveen, NL  
0800-099-33-44



## More than 100,000 Products Available!

### • Temperature

Calibrators, Connectors, General Test and Measurement Instruments, Glass Bulb Thermometers, Handheld Instruments for Temperature Measurement, Ice Point References, Indicating Labels, Crayons, Cements and Lacquers, Infrared Temperature Measurement Instruments, Recorders Relative Humidity Measurement Instruments, RTD Probes, Elements and Assemblies, Temperature & Process Meters, Timers and Counters, Temperature and Process Controllers and Power Switching Devices, Thermistor Elements, Probes and Assemblies, Thermocouples Thermowells and Head and Well Assemblies, Transmitters, Wire

### • Flow and Level

Air Velocity Indicators, Doppler Flowmeters, Level Measurement, Magnetic Flowmeters, Mass Flowmeters, Pitot Tubes, Pumps, Rotameters, Turbine and Paddle Wheel Flowmeters, Ultrasonic Flowmeters, Valves, Variable Area Flowmeters, Vortex Shedding Flowmeters

### • pH and Conductivity

Conductivity Instrumentation, Dissolved Oxygen Instrumentation, Environmental Instrumentation, pH Electrodes and Instruments, Water and Soil Analysis Instrumentation

### • Data Acquisition

Auto-Dialers and Alarm Monitoring Systems, Communication Products and Converters, Data Acquisition and Analysis Software, Data Loggers Plug-in Cards, Signal Conditioners, USB, RS232, RS485 and Parallel Port Data Acquisition Systems, Wireless Transmitters and Receivers

### • Pressure, Strain and Force

Displacement Transducers, Dynamic Measurement Force Sensors, Instrumentation for Pressure and Strain Measurements, Load Cells, Pressure Gauges, Pressure Reference Section, Pressure Switches, Pressure Transducers, Proximity Transducers, Regulators, Strain Gages, Torque Transducers, Valves

### • Heaters

Band Heaters, Cartridge Heaters, Circulation Heaters, Comfort Heaters, Controllers, Meters and Switching Devices, Flexible Heaters, General Test and Measurement Instruments, Heater Hook-up Wire, Heating Cable Systems, Immersion Heaters, Process Air and Duct, Heaters, Radiant Heaters, Strip Heaters, Tubular Heaters